
ASSEMBLY INSTRUCTIONS

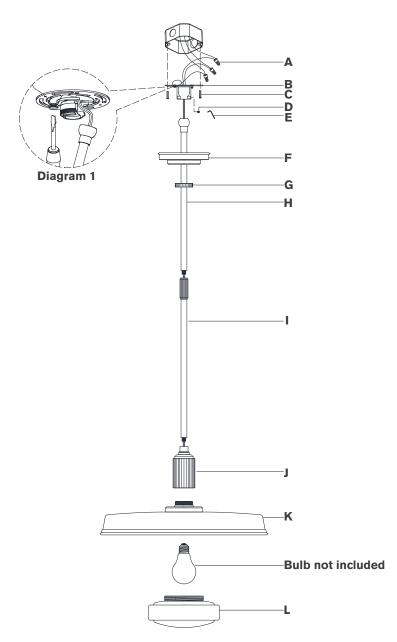

Visual Comfort

Ruhlmann 18" Factory Pendant

Item # CHC 5301

NOTICE:

This light fixture should be installed in accordance with all applicable, local installation codes, and by a person familiar with the construction and operation of it, as well as the hazards involved. Inspect item and contents carefully. If any damage or defect is found, do not install. Retain all packaging material until installation is complete and approved.

TOOLS REQUIRED (NOT INCLUDED):

Phillips Screwdriver Slotted Screwdriver Wire Cutters
Wire Strippers

- 1. Carefully remove all parts from the box. Place on a clean, soft surface.
- 2. Remove mounting plate **(B)** from canopy **(F)** by removing collar ring **(G)**.
- 3. Install mounting plate **(B)** to junction box and secure with mounting screws **(C)**.
- 4. Feed electrical and ground wires through bottom rod (I) and connect to fixture body (J).
- 5. Continue feeding wires through collar ring **(G)**, canopy **(F)** and top rod **(H)**.
- Holding fixture upright, slide collar ring (G) and canopy (F) down and rest on fixture body (J). Then connect top rod (H) to bottom rod (I).
 NOTE: Slide components down slowly to avoid damages.
- 7. Thread metal shade **(K)** to fixture body **(J)**.
- 8. Hang fixture to the center of mounting plate **(B)** and secure set screw **(D)** with provided wrench **(E)**.
- 9. Cut excess wires, being sure to leave enough to reach the junction box.
- 10. Separate two sides of molded wire, and strip insulation on each 5/8".










ASSEMBLY INSTRUCTIONS

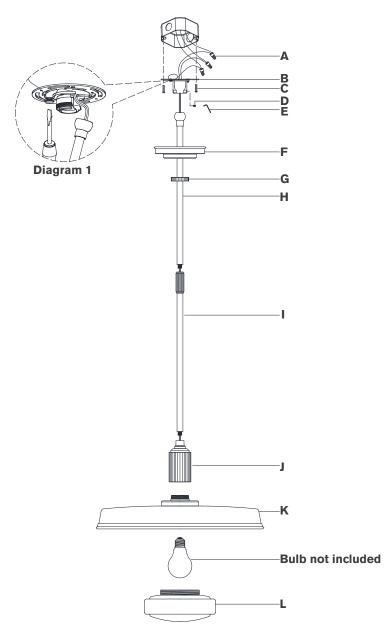

Visual Comfort

Ruhlmann 18" Factory Pendant

Item # CHC 5301

NOTICE:

This light fixture should be installed in accordance with all applicable, local installation codes, and by a person familiar with the construction and operation of it, as well as the hazards involved. Inspect item and contents carefully. If any damage or defect is found, do not install. Retain all packaging material until installation is complete and approved.

11. Wrap fixture ground wire (bare copper) around the green grounding screw (see diagram 1). Tighten. Continue fixture ground wire and connect to supply ground wire (usually green or bare copper) using wire nut (A).

NOTE: It is imperative that the fixture is grounded.

- 12. Connect fixture neutral wire (white) to the supply neutral wire (usually white) using wire nut (A).
- 13. Connect fixture hot wire (black) to the supply hot wire (usually black) using wire nut (A).

CAUTION: Do not reverse the hot and neutral connections.

- 14. Make sure all wire connections are tight, then carefully tuck into the junction box.
- 15. Install canopy **(F)** to mounting plate **(B)** by securing with collar ring **(G)**.
- 16. Install light bulb into the socket.
- 17. Thread glass shade (L) to metal shade (K).

NOTE: Do not overtighten otherwise shade could become damaged.

Care Instructions: Clean only with a soft dry cloth or feather duster. Do Not use abrasive or chemical agents.







